


FOSC-JM4-72







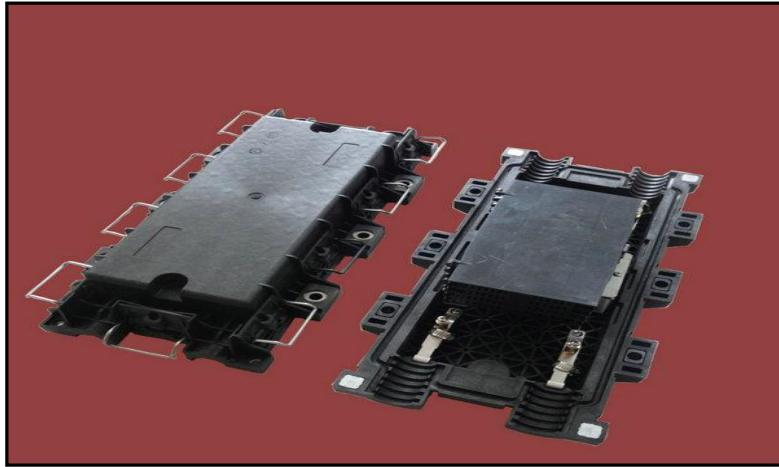




➤ *Feature :*


- Materials: ABS.
- Max capacity: 72c.
- Size: 400*174*112.5mm
- It can be used to connect and branch fibers in aerial locations, direct buried manholes.
- The case body is made from high-intensity engineering plastics and formed the shape will mold plastics under high pressures.
- High mechanical intensity, corrosive-resistance, anti-thunderstruck and long service.
- Adopt high-quality stainless steel screws and hooks. Excellent sealing
- Adopt plastic clip lock way, no need of tools
- Adequate splice space with bending ratio > 37.5mm
- Easy installation, without special training. Re-open structure.
- With various cable fixing rings, suitable for different cable dimensions.

➤ *Main Technical Index :*

- Working Temperature: -40C°~+65C°.
- Atmospheric Pressure: 70~106Kpa.
- Axial Tension : > 100N/1min.
- Flattening Force: > 2000N/10cm² , 1min.
- Insulation Resistance: > 2 × 10⁴MΩ.
- Endurance Voltage strength: 15KV(DC) per 1min, without breakdown and arc.
- Recycling Temperature: -40C°~+65C°, 60(+5)Kpa inside, 10times. Back to normal temperature, the air pressure decrease less than 5kpa.
- Duration: more than 25 years.

➤ **Accessories :**

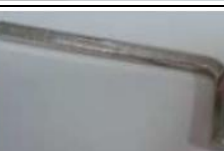N°	Name	Function	Qty	Pic
1	Splice protector	Used to protect fiber fusion joints	Same with splice capacity	
2	Cable tie	Bond the cable	Few pcs	
3	Cable Dia. Adjusting Tape	Adjust cable dia at the entry port	1 roll	
4	Entry port sealing tape	Adust the port lock to make sur full seal of the closure	1 roll	
5	Entry port block	Block the unused entry port	2pcs	
6	Cable fixing support kits	Support the cable for fixing on the cable fixing plate	Several pcs with different dia.	
7	Sheath earth wire	Avoid lighting	1pc	
8	Sealing rubber strip	Sealing around the closure	2pcs	
9	Hexagon wrench	Closure open tool	1pc	

10	Aerial mounting kits	Aerial fixing kits	1pc	
11	Abrasive tape	Make the cable sheath uneven	1pc	